


## Safety notice for skywalk CULT3 XS-S-M rescue handle

A CULT3 – S was found to have a release pin that was too short. A routine check of structurally identical CULT3 harnesses in sizes XS, S and M verified the correct sizes of the release pin. Nevertheless, in agreement with the DHV, skywalk has released the following safety notice:

Skywalk recommends that all pilots, who have harnesses with the serial number, listened below, should check the length of the plastic release pins before the next flight or to have them checked at a flight school.

The handle delivered, with the skywalk CULT3, has three independent plastic wires, that are responsible for securing the 4-leaf bottom container. The correct length is gauged from the handle to the end of the plastic wire.

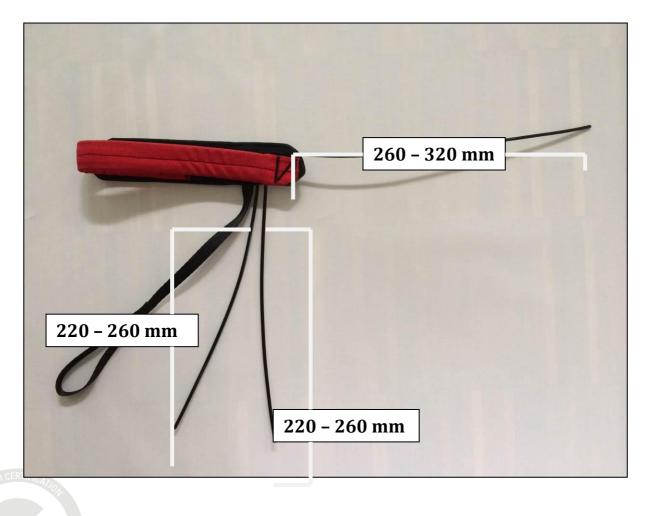

If the actual length is shorter than the indicated values, the container can be inadvertently open and cause the rescue equipment to fall out. In the worst case it can fall out during flight without the pilot noticing.

e-walk.org

Company registration number: HRA 7710 Register court: HR Traunstein represented by: Skywalk Verwaltungs-GmbH Company registration number: HRB 14113 Register court: HR Traunstein General Manager: Thomas Allertseder | Manfred Kistler



skywalk.info








Should a handle with too short plastic wires be found, the affected pilot should report this to skywalk, stating the serial number. Skywalk will send immediately a correct handle or, if needed, ensure that a replacement is sent.

The lengths can be easily measured with the handle installed with the help of a tape measure.



For the second plastic wire, you can hold the end of the tape measure against the end of the wire or remove the first wire, as depicted in the photo below. After the measurement, secure the first wire again as described in the instructions.

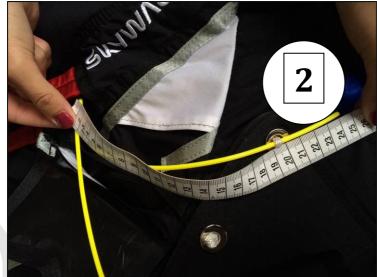









e-walk.org







The following serial numbers might be affected:

## CULT3 XS

SHCU3GXS-0712-00580

SHCU3GXS-5111-00309 to SHCU3GXS-5111-00318

SHCU3GXS-0712-00579

## CULT3 S

SCCU3GS-3412-0906	to	SCCU3GS-3412-0915
SHCU3GS-2212-876	to	SHCU3GS-2212-880
SHCU3GS-1912-598	to	SHCU3GS-1912-602
SHCU3GS-2212-816	to	SHCU3GS-2212-825
SHCU3GS-5111-00319	to	SHCU3GS-5111-00338
SHCU3GS-0712-00581		

SHCU3GS-0712-00582



Company registration number: HRA 7710 Register court: HR Traunstein persented by: Skywalk Verwaltungs-GmbH Company registration number: HRB 14113 Register court: HR Traunstein General Manager: Thomas Allertseder | Manfred Kistler



skywalk.info



e-walk.org







## CULT3 M

SHCU3GM-3412-876	to	SHCU3GM-3412-905
SHCU3GM-2212-776	to	SHCU3GM-2212-815
SHCU3GM-2112-666	to	SHCU3GM-2112-680
SHCU3GM-1912-603	to	SHCU3GM-1912-612
SHCU3GM-0712-00584 SHCU3GM-0712-00585 SHCU3GM-0712-00586		
SHCU3GM-5111-00362	to	SHCU3GM-5111-00378
SHCU3GM-5111-00339	to	SHCU3GM-5111-00361
SHCU3GM-0712-00595		

Manfred Kistler, 5.6.2014

Managing director Skywalk GmbH & Co KG



Company registration number: HRA 7710 Register court: HR Traunstein persented by: Skywalk Verwaltungs-GmbH Company registration number: HRB 14113 Register court: HR Traunstein General Manager: Thomas Allertseder | Manfred Kistler



skywalk.info



e-walk.org



